

YEAR
1992 – 93

MODEL
INTEGRA

VIN APPLICATION
See VEHICLES
AFFECTED

BULLETIN NO.
96-022



Warranty Extension: 1992 – 93 Integra Distributor

BACKGROUND

Climate and driving conditions in the southeastern part of the U.S., California, Hawaii, and Puerto Rico may cause the distributor bearing to develop excessive clearance. If this happens, the engine will not start.

This problem is rare in the northern part of the country. However, in the interests of customer satisfaction, American Honda is extending the warranty on the distributor assembly in that area to 6 years or 100,000 miles, whichever comes first.

VEHICLES AFFECTED

1992 Integra: ALL

1993 Integra:

2-door RS, LS, GS – Thru VIN JH4DA9. . .PS021690

4-door RS, LS, GS – Thru VIN JH4DB1. . .PS003558


2-door GSR – Thru VIN JH4DB2. . .PS000804

GENERAL INFORMATION

Owners who live in the shaded area of the map shown below will be notified that the warranty on the distributor assembly has been extended. They will be advised to contact the dealer for repair *only if the distributor fails*. The text of the customer letter is at the end of this service bulletin.

A Product Update Campaign is being conducted in the southeastern U.S., California, Hawaii, and Puerto Rico. Refer to the maps and zip code information in service bulletin 96-015, *Product Update Campaign: 1992 – 93 Integra Distributor*.

WARRANTY EXTENSION AREA

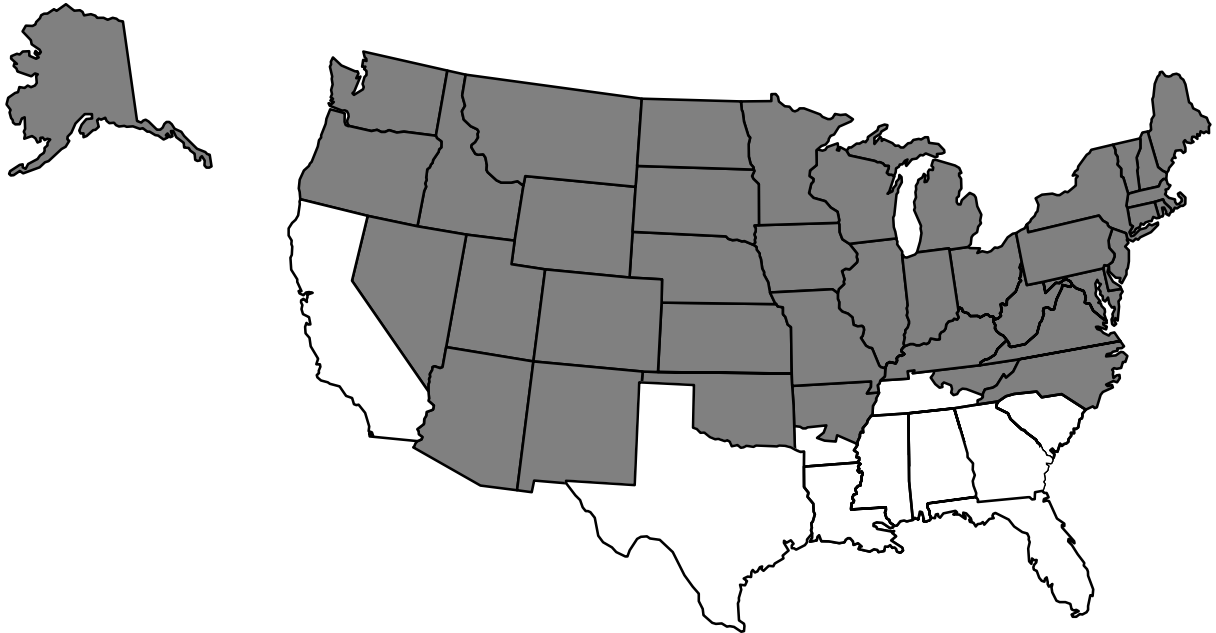

The shaded area in the above map shows the states that are included in the Warranty Extension. Two states, Arkansas and Tennessee, are partly in Region B of the Product Update, and partly in the Warranty Extension area.

Arkansas—If the first two digits of the customer's zip code are 71, then that customer is in Region B of the Product Update. If the first two digits are not 71, then the customer is covered by the warranty extension.

Tennessee—If the first two digits of the customer's zip code are 38, then that customer is in Region B of the Product Update. If the first two digits are not 38, then the customer is covered by the warranty extension.

CORRECTIVE ACTION

When the customer's car comes in with a failed distributor, replace the distributor housing assembly with the new assembly listed under PARTS INFORMATION. Use the existing coil, igniter, leak cover, rotor, cap seal, and distributor cap.

Diagnosis

Inspect the distributor bearing for excessive clearance by confirming one or more of the following:

- Excessive noise when the distributor is rotated.
- Red or brown dust inside the distributor.
- The distributor shaft will not turn.

PARTS INFORMATION

Distributor housing assembly:

- RS, LS, GS – P/N 06301-PR4-A01
- GSR – P/N 06301-P30-A01

WARRANTY CLAIM INFORMATION

OPERATION NUMBER	DESCRIPTION	FLAT RATE TIME	TEMPLATE ID
117137	Replace distributor housing, RS, LS, GS	0.5 hour	96-022A
117137	Replace distributor housing, GSR	0.5 hour	96-022B

Failed P/N: 30102-PT2-016
 Defect code: 722
 Contention code: K09

Example of customer letter

June 1996

**Warranty Extension: 1992 – 93 Integra
Distributor Assembly**

Dear Integra Owner:

American Honda has determined that the hot, humid climate and driving conditions in the southeastern part of the U.S. may affect the durability of the distributor bearing, a part in the Integra's ignition system.

Although you do not live in an area where the bearing's durability is an issue, Acura is extending the warranty on your car's distributor assembly to 6 years or 100,000 miles, whichever comes first, from the date your car was first sold. This is in the interests of customer satisfaction.

It is very unlikely that your car's distributor will ever develop a problem. But, if it does, your Acura dealer will replace it free of charge under this warranty extension.

If you have questions about this warranty extension, please call Acura Customer Relations at (800) 382-2238.

Sincerely,
AMERICAN HONDA MOTOR CO., INC
Acura Automobile Division